

PL[®] PREMIUM MAX Construction Adhesive

DESCRIPTION

Loctite[®] PL PREMIUM MAX is the strongest, most durable construction adhesive that remains 100% solid* after curing. Thanks to the unique high solid content adhesive technology, this product is ideal for most interior or exterior projects where long-term strength and durability are a must. It can be applied to dry or wet surfaces and in both cold (down to 10° F) and hot (120° F) temperatures. Great for framing, flooring, stairs, railings, most landscaping and deck projects; and other construction or remodeling projects.

* In typical conditions based on ASTM D3498 for dry lumber and gap filling effect on strength

Available As:

Item #	Package	Size
2292244	Plastic Cartridge	9 fl. oz. (266 mL)

FEATURES & BENEFITS

- Strongest bond to most materials / Weatherproof
- Remains solid and doesn't develop air pockets
- Fast grab and Repositionable
- Easy to gun in cold weather
- No run-on
- For indoor and outdoor use
- Full cure in 24-48 hours
- Cleans up with mineral spirits

RECOMMENDED FOR

Bonds to most common construction materials such as wood, plywood, OSB, MDF, hardwood flooring, concrete, stone *, granite, marble, tile, slate, masonry, brick, foamboard insulation including EPS (expanded polystyrene foam), XPS (extruded polystyrene foam), porcelain, metal, stainless steel, galvanized metal, cement-based products, ceramic, fiberglass, drywall, rigid and cellular vinyl/PVC trim and molding.

LIMITATIONS

- Marine Applications
- Water submersion applications
- Polyethylene, polypropylene, polytetrafluoroethylene (PTFE), and flexible vinyl (FPVC)
- Polyethylene (PE) films that cover certain XPS or EPS foam insulation boards
- Bitumen coated surfaces
- Certain natural stones* such as limestone, travertine, sandstone will have bonding difficulties
- Certain materials such as rubbers and plastics may have bonding difficulties. Test before use.
- Not for use on composite decking and Ipe wood materials
- Flexible sheet goods
- Areas of high heat such as around fireplace openings or for fire pit construction
- All treated lumber must be well seasoned for at least 6 months in weather exposure.

COVERAGE

For a 9-fl. oz. cartridge:

- A 1/4" (6 mm) bead extrudes approximately 30.6 ft. (9.3 m)
- A 3/8" (9.5 mm) bead extrudes approximately 13.6 ft. (4.1 m)

TECHNICAL DATA

Typical Uncured Physical Properties:

Color:	Grey	Specific Gravity:	1.6 – 1.7
Appearance:	Thick paste	VOC Content:	≤ 4.0% by weight (≤ 64 g/L)
Base:	Silane Modified Polymer	Shelf Life:	18 months from date of manufacture (unopened)
Viscosity:	1,200,000 cps		

Lot Code Explanation: 18060
18 = Last Two Digits of Year of Manufacture
060 = Day of Manufacture based on 365 days per year
Example: 18060 = March 1, 2018

Typical Application Performance Properties:

Application Temperature:	The adhesive should be above 10°F (-12°C) and below 120°F (49°C) for application.	Clamping Time:	24 hours
Odor:	Alcohol	Cure Time**:	24 to 48 hours* at 78°F (25°C) and 50% RH
Open Time:	20 minutes*	Clean Up:	Clean up uncured adhesive residue with mineral spirits. Scrape away cured adhesive using a sharp-edged tool. Follow solvent manufacturer's precautions for using solvents.
Repositioning Time:	15-20 minutes*		

* Time is dependent upon temperature, humidity, porosity of substrate and amount of adhesive used

** Cure time is significantly increased in cold temperatures and/or low humidity conditions

Typical Cured Performance Properties:

Color:	Grey	Sandable:	Yes
Cured form:	Non-flammable, hard solid	Paintable:	Yes, after fully cured with latex paint only
Service Temperature:	0°F (-18°C) to 160°F (71°C)		
Water Resistance:	Yes		
<u>Compression Shear Strength, ASTM D3498:</u> Douglas Fir to Douglas Fir plywood		<u>Applicable Specifications:</u>	
Dry Lumber Bonding	1275 psi (8.79 N/mm ²)	• ASTM D 3498	
Wet Lumber Bonding	717 psi (4.94 N/mm ²)	• APA AFG-01	
Frozen Lumber Bonding	904 psi (6.23 N/mm ²)	• ASTM C 557	
Gap Filling	631 psi (4.35 N/mm ²)		
Moisture Resistance	1117 psi (7.7 N/mm ²)		

DIRECTIONS

Tools Typically Required:

Utility knife, caulking gun, tool to puncture cartridge seal, plant mister bottle containing water.

Safety Precautions:

Wear gloves to avoid skin contact and wash hands after use.

DIRECTIONS**Preparation:**

Use above 10°F (-12°C). For easier application, ensure the product temperature is 60°F (15°C) or higher but below 90°F (32°C). Surfaces must be clean and free of frost, standing water, grease, oil, dust, release agents, and other contaminants. Pre-fit all materials and protect finished surfaces. Cut nozzle at a 45° angle to required opening, at least ¼ inch or wider. Puncture the inner seal of the cartridge. The foil seal must be completely opened using a tool of comparable size as the opening. Be very careful not to allow PL Premium Max to cure on a finished surface.

General Application Guidelines:

Apply adhesive to one surface of the materials being bonded. Press the surfaces firmly together within 20 minutes. Materials may be repositioned within 15-20 minutes after applying the adhesive. If bonding two non-porous surfaces (such as foam, metal and fiberglass) or under very dry conditions (less than 30% relative humidity), add water in the form of a very light or atomized spray from a plant mister bottle to the extruded adhesive. The repositioning time will then be reduced to less than 10 minutes. Use mechanical support or temporary bracing for 24-48 hours depending upon project requirements while the adhesive cures. Cure time is dependent upon temperature, humidity, porosity of substrate and amount of adhesive used. Low temperature and humidity will slow cure time. When bonding EPS and XPS foam insulation, avoid cure and surface temperatures above 90°F (32°C).

Bonding Drywall, Vinyl Board, or Paneling to wall surfaces:

For bonding to relatively smooth and level surfaces apply adhesive as a series of vertical beads 10 inches apart (perimeter gluing is not recommended). Start the beads approximately 1 inch from the panel edge applying ¼" to ⅜" round beads of adhesive. Immediately after applying the adhesive place the foam against the substrate and press firmly into place to flatten out the adhesive. Be careful not to over press. Mechanical fasteners or temporary bracing must be used and kept in place until the adhesive is fully cured depending upon the project requirements. Cure time will vary depending on the porosity of the material used, the humidity and the temperature at time of application.

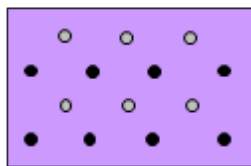
When bonding drywall or paneling to wood/metal stud framing, apply ¼" to ⅜" round bead of adhesive to each stud starting 3 inches from top and ending 3 inches from bottom. All drywall applications require perimeter nailing/screws 16" O.C. and 24" O.C. in the field following the Adhesive Nail-On Attachment Method for gypsum wallboard. Temporary support or bracing is required for prefinished panels until adhesive is fully cured. Mechanical fasteners may be required at the top and bottom of each prefinished panel.

Drywall application over foam insulation:

Apply not less than ¼" round beads of adhesive as outlined above. Position drywall, align and press firmly into place. Perimeter fasten to underlying studs or strapping around entire perimeter. It is recommended to brace the center or field of the panels for at least 24 hours. Mechanical fasteners must be used and kept in place until adhesive is fully cured. Furring strips are recommended for concrete wall applications.

SPECIAL APPLICATIONS**Mirrors:**

Using a caulking gun, apply adhesive dollops to back of mirror in 2 to 3-inch (5 to 7.5 cm) diameter spots approximately 1/2" (12 mm) thick for every square foot of mirror (see Fig.1). Do not place the adhesive too close to the edge to prevent squeeze out. A permanent support system, such as plastic holders or clips, or mirror channels must be used to hold mirrors in place, both at the top and bottom of mirror. Heavy mirrors may require an additional support system. Place mirror in position, in supports, and carefully press into place within 20 minutes of application. The adhesive should be compressed so that it is approximately 1/8 inch (3 mm) thick. Do not attempt to remove or reposition the mirror once adhesive has started to cure. Brace top of mirror to hold in place while the adhesive cures, usually 24 hours. Mirrors should not be mounted to wallpaper, painted surfaces, plaster, natural stone, fire retardant plywood, pressure treated wood or any surface that is damaged or not structurally sound. Total time required for curing depends upon temperature, humidity, porosity of substrate and amount of air that can reach the adhesive. For non-porous surfaces longer curing time will be required. Fully sealing around the edges may extend cure times.

**Fig.1**

SPECIAL NOTE: Not recommended for overhead mirror installations. Not recommended for mirror overlays. Do not apply horizontal or continuous adhesive beads. Do not use on mirrors exhibiting damage or scratches on the mirror backing as adhesive may cause damage to reflective coating.

DIRECTIONS

Tub Surrounds:

Preparation:

1. The adhesive is dark gray in color and requires that the wall be painted a dark color as the adhesive may show through the surround.
2. The temperature of the adhesive, the surfaces and the working area must be above 50°F (10°C).
3. Walls must be dry and free of dirt, waxes and soap or other residues. Painted glossy surfaces require sanding. Remove all paint, wallpaper, old adhesive or any loose materials. Unpainted, waterproof drywall or cement board is the best backing for tub and shower units. Use primer to seal areas having exposed joint compound.
4. Lay panels flat and allow them to come to room temperature (65°F to 75°F) for at least 24 hours before installing. Wipe back of panels with an IPA (Isopropyl alcohol) to remove any possible release agents. Do not use bent or bowed panels. Make sure that corners are 90° from top to bottom.
5. Pre-fit all materials following the tub surround manufacturer's instructions before using adhesive. Use the cardboard box that the tub kit came in as the template. Measure the spout and faucet placement onto the cardboard template and make the cut-outs. Position the cardboard in place on the wall and check for the correct cut-out placement. Transfer the markings on the tub panel. Make all the cuts in the tub panel using a hole saw bit in an electric drill. Drill a small starter hole. Make all the cuts from the face or front panel surface to the rear or backing surface. This will prevent chipping. Set each tub panel in place in the order suggested by the manufacturer. Limit stressing the tub unit into place, as this will weaken the material.
6. Use masking tape to temporarily support the tub panels in place. Make sure the tops of all panels are levelled and all the pieces are aligned. Using a pencil, outline the tub panels in their correct position before gluing.
7. Place the adhesive cartridge in a caulking gun and cut the nozzle at a 45° to desired bead size (1/4" minimum). Puncture inner seal. Do not get adhesive on finished parts of tub surround. If this happens remove immediately using mineral spirits to clean wet adhesive from surface following solvent manufacturer's precautions with plastics surfaces.

Application: Apply the adhesive in continuous 1/4" vertical beads to paneling starting 1" (2.5cm) in from the edges and continuing from top to bottom every 6 inches (15 cm) across the back panel. Do not apply adhesive where the panel will not make contact with the wall (for examples curved corners). Press the tub surround panel firmly in place within 10 minutes of applying adhesive. Apply hand pressure across the entire panel surface to ensure good adhesive contact.

Alternate Application Method: Adhesive may be applied in continuous "S" pattern every 8 inches (20 cm) apart and only on flat sections that closely mate with existing wall surface.

NOTE: All application methods will require bracing for at least 24-48 hours to maintain contact while adhesive cures. Panel edges can be supported with masking tape. After 20 minutes hand press again over all areas of installation to ensure good contact. Connect seams of panels according to tub surround manufacturer instructions. Edges can be sealed after at least 24 hours after installation but not before hand. Allow at least 24 hours after sealing before using the area.

Clean-up:

Clean tools and adhesive residue immediately with mineral spirits. Loctite® PL® Premium Max can only be removed mechanically once cured.

STORAGE & DISPOSAL

Not damaged by freezing. Store product at standard conditions which are defined as 72 ± 4°F (22 ± 2°C) and <50% relative humidity. After completion of work, seal cartridge nozzle tightly with aluminum foil. Wrap the foil tightly around the nozzle and seal it with tape. Applying petroleum jelly around the opening before sealing with aluminum foil can create a more airtight seal. Product cures with exposure to moisture. Use an approved hazardous waste facility for disposal.

LABEL PRECAUTIONS

WARNING: Contains Crystalline silica and silanes. May be harmful if inhaled or swallowed. Methanol is released during application and cure, which may affect the nervous system causing dizziness, headache, or nausea. Use in a well-ventilated area. Do not breathe vapors. Avoid eye and skin contact. Prolonged or repeated skin contact with uncured adhesive may cause an allergic reaction. Wear impermeable gloves and safety glasses when applying product. Remove contact lenses before using adhesive. Wash hands after using.

FIRST AID: For eye contact flush with water for 15 minutes. Call a physician if irritation develops and persists. For skin contact, wash thoroughly with soap and water. If affected by inhalation, remove to fresh air and get medical attention. If ingested, do not induce vomiting; call a physician or Poison Control Center immediately.
DO NOT TAKE INTERNALLY. KEEP OUT OF THE REACH OF CHILDREN.



WARNING: Cancer and Reproductive Harm – www.P65Warnings.ca.gov.

Refer to the Safety Data Sheet (SDS) for further information

DISCLAIMER

The information and recommendations contained herein are based on our research and are believed to be accurate, but no warranty, express or implied, is made or should be inferred. Henkel recommends purchasers/users should test the products to determine acceptable quality and suitability for the intended use. All adhesive/sealant applications should be tested under simulated or actual end use conditions to ensure the adhesive/sealant meets or exceeds all required project specifications. Since assembly conditions may be critical to adhesive/sealant performance, it is also recommended that testing be performed on specimens assembled under simulated or actual production conditions. Nothing contained herein shall be construed to imply the nonexistence of any relevant patents or to constitute a permission, inducement or recommendation to practice any invention covered by any patent, without authority from the owner of the patent.

LIMITED WARRANTY

This product is warranted by Henkel Corporation to be free from defects in materials when used as directed. Henkel's sole obligation shall be, at its option, to replace or refund the purchase price of product proven to be defective. Henkel makes no other warranty – express or implied – including warranties of MERCHANTABILITY and FITNESS FOR A PARTICULAR PURPOSE and will not be liable for consequential or incidental damages. This Limited Warranty gives you specific legal rights, which vary from state to state. For warranty assistance, contact Henkel at 1.800.624.7767 M-F 9:00 am to 4:00 pm ET.



Trusted Performance. Proven Results.

For over 50 years, Loctite Brand adhesives and sealants have taken on the toughest jobs. Used in race cars, airplanes, and even in the space-shuttle, Loctite provides solutions for the most demanding industrial, professional and consumer applications. Loctite gives you not the specialization, power and performance to not only get your job done, but to get it done right.

For Technical Assistance call : 1-800-624-7767 – Mon-Fri - 9:00a – 4:00p ET

www.loctiteproducts.com



Loctite Brand is part of the Henkel family of brands. Founded in 1876, Henkel is a global leader in the consumer and industrial businesses. Henkel operates worldwide with leading brands and technologies in three business areas: Laundry & Home Care, Beauty Care and Adhesive Technologies.

Henkel Corporation - Professional & Consumer Adhesives Headquarters - Rocky Hill, CT 06067

www.henkelna.com